


GIUNTO GIREVOLE IN LINEA
Swivel joint line mounting

Tab 10/05

DENOMINAZIONE *DENOMINATION*
GG / ..


CODICE *CODE*
600.X001.000

da ¼ a ½

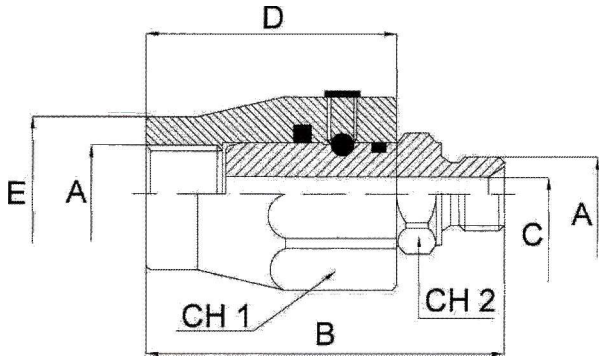

X	*Collettore* *Body*
1	1/4
2	3/8
3	1/2
4	3/4
5	1”
6	1”1/4
7	1”1/2
8	2”

da ¾ a 2”

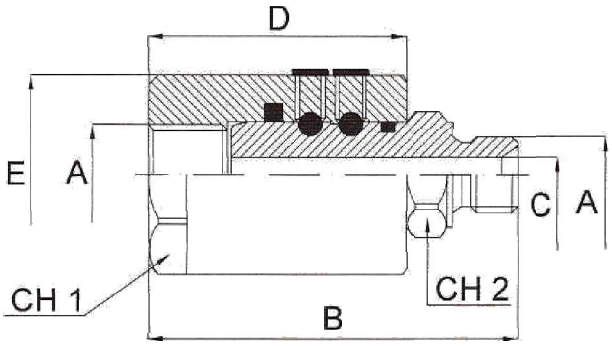

A RICHIESTA AISI 316 E GUANIZIONI SPECIALI

ON REQUEST STAINLESS STEEL AND SPECIAL GASKET

TIPO - *TYPE*	**A**	**B**	**C**	**CH1**	**CH2**	**D**	**E**	**Pressione max di rotazione** *Max rotation pressure*	**Pressione max statica** *Max static pressure*
GG/14	1/4	61	6	30	19	42	24	200	400
GG/38	3/8	66	8,5	34	24	44	25	200	400
GG/12	1/2	71	11,5	36	27	47	32	150	300
GG/34	3/4	80	15	45	34	50	49,5	150	300
GG/100	1”	90	21	50	41	57	54,5	100	300
GG/114	1”1/4	101	28	55	50	63	60	100	300
GG/112	1”1/2	110	35	65	55	70	69,5	80	300
GG/200	2”	118	44	75	65	75	84,5	50	250

Attenzione: I giunti girevoli in linea e a 90° NON sono idonei per rotazioni veloci e continuative, ma solo per spostamenti angolari

APPLICAZIONE: sono raccordi speciali che consentono il collegamento idraulico tra elementi in movimento tra loro con rotazioni alternate o continue/discontinue. Adatti per spostamenti angolari anche in pressione. Temperatura -20°C/+80°C.

APPLICATION: rotary joint is used to connect two hydraulic lines that are moving each other in different ways or speed. It accepts continue or alternative rotation with max pressure too. **Warning: The swivel joints in line and 90 ° are NOT eligible for fast and continuous rotation, but only for angular displacement. Temperature : -20°C/+80°C.**

.